





WJ DANA 60 REAR ABS SET – UP

- AFTER INSTALLING THE AXLE SHAFTS AND WHEEL SPEED SENSORS. CHECK AIR GAP BETWEEN TONE RING AND ABS SENSOR. AIR GAP NEEDS TO BE SET TO .020-.035.
- IF AIR GAP NEEDS TO BE ADJUSTED GRIND DOWN ONE SIDE OF METAL SPACER AT AN ANGLE SO THAT SPEED SENSOR WILL ANGLE IN TOWARDS TONE RING.

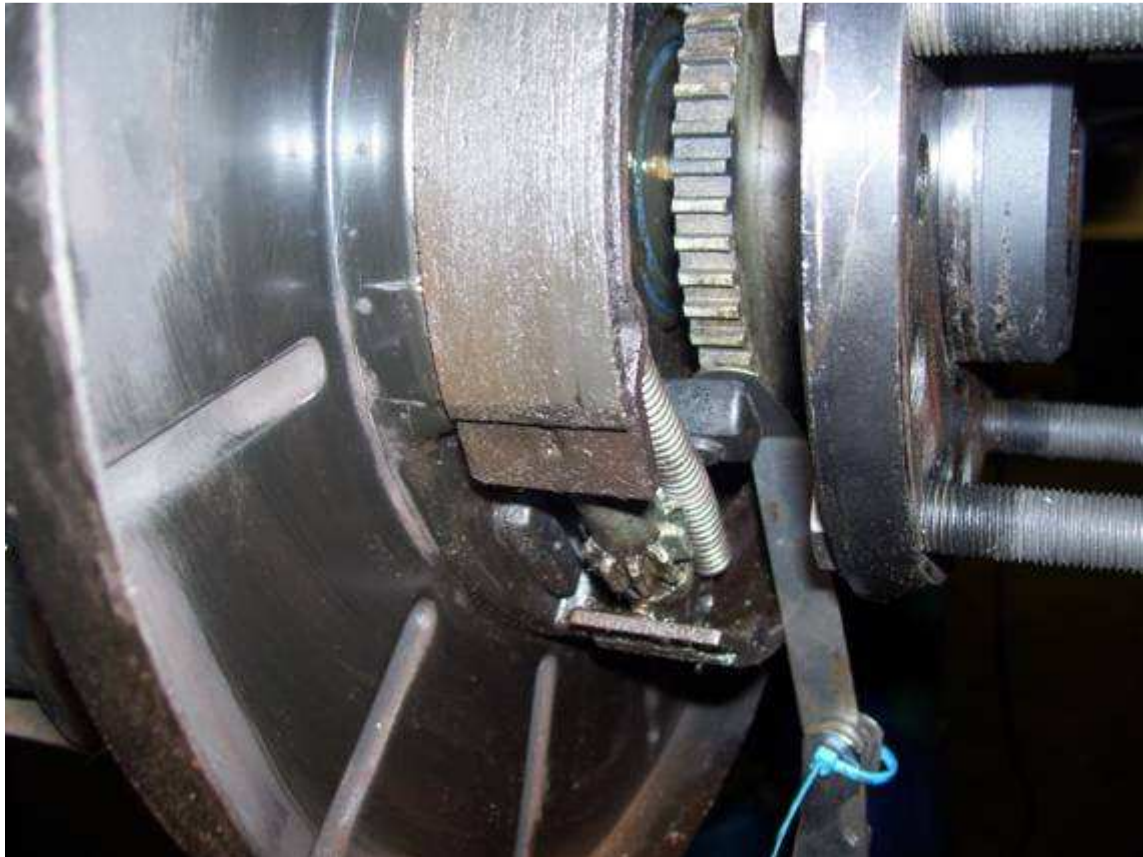

- Picture shows placement of feeler gauge with proper spacing. Also notice round nub on backside of speed sensor this is where tone ring needs to be aligned.

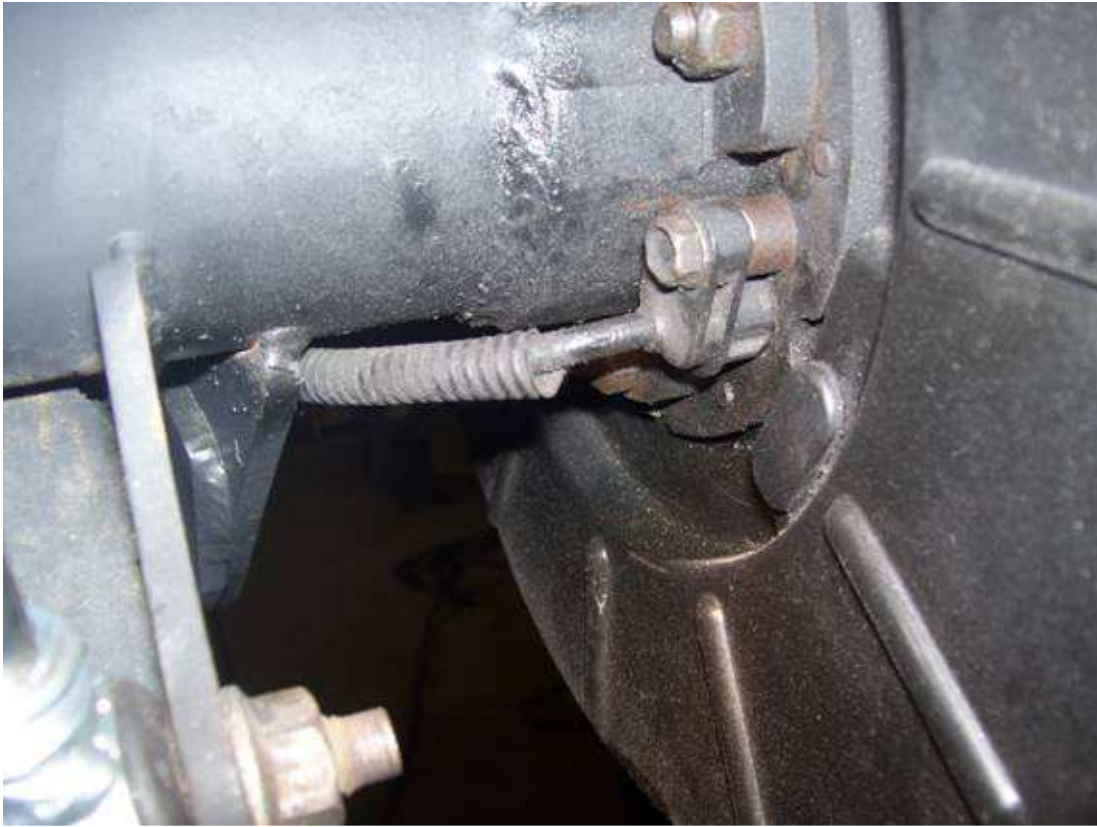

- **Picture shows metal spacer installed with longer supplied bolt.**



- * **Pictures shows Brake line, E-brake cable, And ABS sensor wire routing.**